

930

Job # 3513

Transport Maintenance (3rd Ave) Ltd.

chassis 23930

Cnr 3rd Ave & Glasgow St, Tauranga

PO Box 2270

Ph. (07) 577 9895

Fax (07) 578 8249

() measurements before aligning.

Reg.nr Type 4 axle SAF Miles/Km Dat. 13/04/11

Name Pometts Inv. nr. 98680 Sign. G. Debra

132
158
-26


A ₁	142
B ₁	141
C ₃	+1 : D _m 4 =

CAMBER	
+15'

139
142
-3

A ₁	140
B ₁	139
C ₅	+1 : D _m 4 =

CAMBER	
+20'

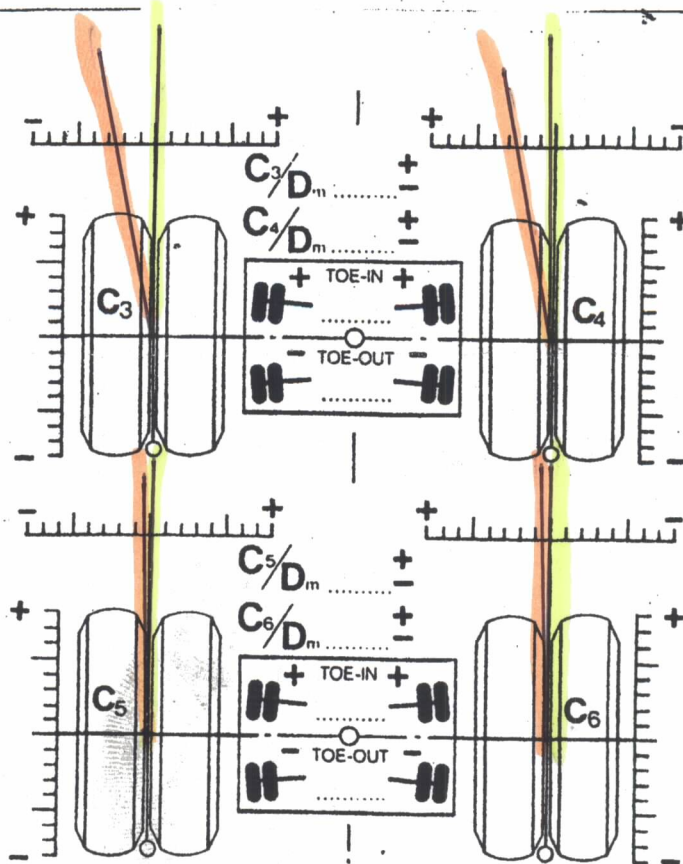

154
126
+28

142	A ₂
141	B ₂
-D _m 4 : +1	C ₄

CAMBER	
+15'

143
140
+3

142	A ₂
141	B ₂
-D _m 4 : +1	C ₆

CAMBER	
+20'



125
140
-23


A ₁	139
B ₁	138
C ₃	+1 : D _m 6 =

CAMBER	
+20'

125
140
-15

A ₁	139
B ₁	138
C ₅	+1 : D _m 6 =

CAMBER	
+15'

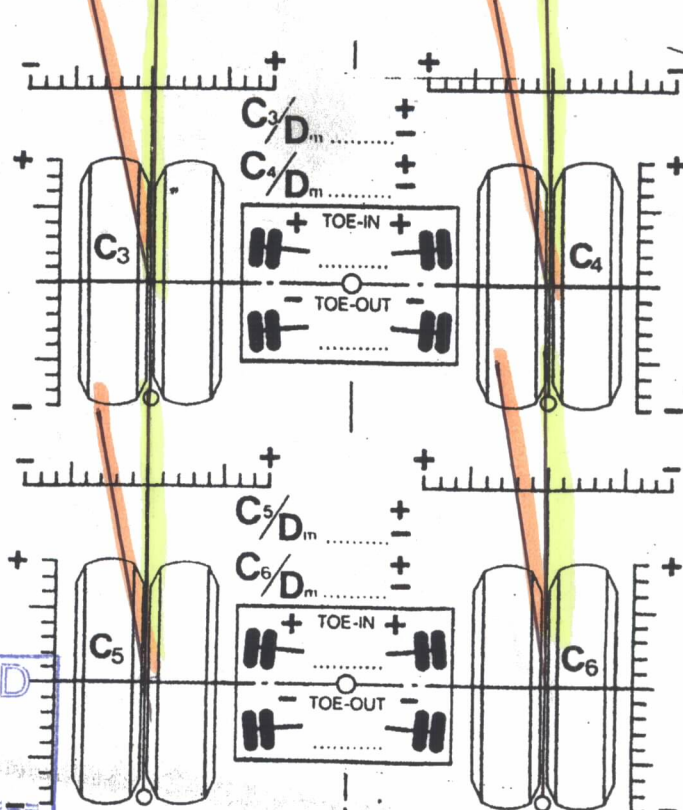

165
140
+25

140	A ₂
139	B ₂
-D _m 6 : +1	C ₄

CAMBER	
+20'

158
142
+14

145	A ₂
145	B ₂
-D _m 6 : +0	C ₆

CAMBER	
+15'

RECEIVED
26 APR 2011